
SPECIFICATION SUBMITTAL SHEET

CHICAGO FITTINGS | X-RISER® FOR LIQUID PROPANE

UPC	Model #	Description (Size)	SDR	Conduit Length	Master Carton Qty	MAKE SELECTION BELOW
	FLEXIBLE A	NODELESS RISER - LIQUID PROPAN	IE with	HEAT SHIE	LD / LINER	
	XR-10B-8-36-L-ZDC	1/2" CTS (.090 WALL) x 1/2" MPT	7	36"	20	
Chicaso	XR-10B-8-72-L-ZDC	1/2" CTS (.090 WALL) x 1/2" MPT	7	72"	20	
Fittings	XR-10B-12-36-L-ZDC	1/2" CTS (.090 WALL) x 3/4" MPT	7	36"	20	
	XR-10B-12-72-L-ZDC	1/2" CTS (.090 WALL) x 3/4" MPT	7	72"	20	
	XR-10B-12-96-L-ZDC	1/2" CTS (.090 WALL) x 3/4" MPT	7	96"	20	
	XR-17C-12-36-L-ZDC	3/4" IPS (.095 WALL) x 3/4" MPT	11	36"	10	
	XR-17C-12-72-L-ZDC	3/4" IPS (.095 WALL) x 3/4" MPT	11	72"	10	
DETAIL	XR-17C-12-96-L-ZDC	3/4" IPS (.095 WALL) x 3/4" MPT	11	96"	10	
VIEW						

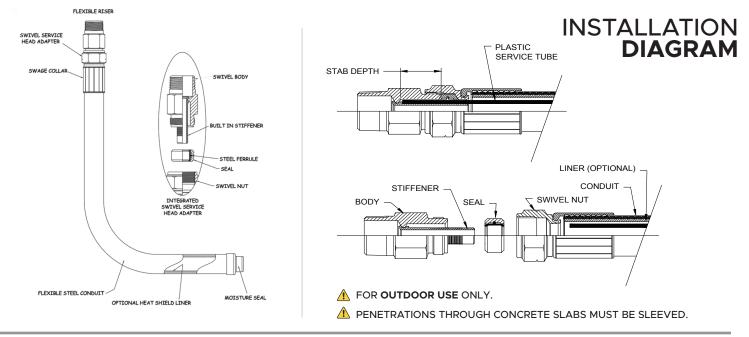

JOB NAME:			
JOB LOCATION:			
CONTRACTOR:	DATE:	ITEM TAG:	
ENGINEER APPROVAL:	DATE:	PART NUMBER:	

www.hydrapro.biz | (800) 849-4844 | Fax (877) 249-8435 Atlanta (GA) • Dallas (TX) • Houston (TX) • Pompano Beach (FL) • Jackson (MI)

SPECIFICATION SUBMITTAL SHEET

CHICAGO FITTINGS | X-RISER® FOR LIQUID PROPANE

- No underground joints
- No chamfering
- Bi-directional seal can't be installed improperly
- No torque requirements
- Integral barbed stiffeners are permanent for additional pull out resistance

3.1 Bodies	3.1.1	Tubing AISI C1013		MATERIAL		
	3.1.2	Bar AISI C12L14, C1213, C1215		DEFINITIONS		
	3.1.3	Bar CDA836 85-5-5-5 Bronze				
	3.1.4	Bar CDA360 Free Machining Brass				
3.2 Nuts	3.2.1	Tubing AISI C1013				
	3.2.2	Bar AISI C12L14, C1213, C1215				
	3.2.3	Bar CDA836 85-5-5-5 Bronze				
	3.2.4	Bar CDA360 Free Machining Brass	i			
3.3 Seals	3.3.1	Seals shall be manufactured from	a Buna-N compound mate	erial that will resist		
		deterioration from age or air under normal storage conditions. The seal will resist				
		deterioration from impurities normally found in natural gas or LP gas including				
		odorants, liquid hydrocarbons, ca	rbon dioxide and water. T	he compound shall meet		
		the following specifications:				
		Color: Black/Red	Durometer: 75 +/-5			
		Elongation: 150%	Tensile Strength: 1,500 p	si min.		
3.4 Ferrules	3.4.1	Cold Rolled Strip C1050				
3.5 Insulators	3.5.1	Zytel 105				
3.6 Conduit	3.6.1	Core Material: Hot Dipped Galvan	ized Steel			
	3.6.2	Jacket Wall: Liquid Tight, Sunlight	t Resistant			
	3.6.3	Crush Resistance: 1,200psi min. in	accordance with UL 360			
3.7 Casing	3.6.1	Pipe/Tubing ASTM A53, ASTM A5	13			
3.8 Moisture Seals	3.7.1	Hot Dipped Vinyl				


INSTALLATION PROCEDURE

- 1. Remove body and install body into meter valve, regulator or piping system First.
- 2. Insert plastic service tube thru the riser assembly and extend the plastic a minimum of 5" past the end of swivel nut.
- 3. Cut the plastic tubing square and deburr O.D. and I.D. Clean exposed tubing with a clean, dry, grease free cloth making sure not to scratch the surface of the plastic tubing.
- 4. Mark tubing to stab depth (SEE CHART) with felt tip pen or suitable marker. Make sure not to scratch surface of plastic tubing with marker.
- 5. Slip seal over plastic service tube and slide seal into the swivel nut.
- 6. Stab plastic up into body until end of body is flush to within a 1/8" of the mark.
- 7. Push swivel nut towards body threads and engage threads. Tighten swivel nut and body until fitting becomes iron bound, that is, "metal to metal".

SPECIFICATION SUBMITTAL SHEET

CHICAGO FITTINGS | X-RISER® FOR NATURAL GAS

UPC ®	Model #	Description (Size)	SDR	Conduit Length	Master Carton Qty	MAKE SELECTION BELOW	
	FLEXIBLE ANODELESS RISER - NATURAL GAS						
Children Fittings	XR-10B-8-36-ZDC	1/2" CTS (.090 WALL) x 1/2" MPT	7	36"	20		
	XR-10B-12-36-ZDC	1/2" CTS (.090 WALL) x 3/4" MPT	7	36"	20		
	XR-13B-8-36-ZDC	1/2" IPS (.090 WALL) x 1/2" MPT	7	36"	15		
	XR-17C-12-36-ZDC	3/4" IPS (.095 WALL) x 3/4" MPT	11	36"	10		
	XR-21J-16-36-ZDC	1" IPS (.119 WALL) x 1" MPT	11	36"	7		
	XR-27G-20-36-ZDC	1-1/4" IPS (.151 WALL) x 1-1/4" MPT	11	36"	5		
DETAIL VIEW	XR-27H-20-36-ZDC	1-1/4" IPS (.166 WALL) x 1-1/4" MPT	10	36"	5		
	XR-31K-24-36-ZDC	1-1/2" IPS (.173 WALL) x 1-1/2" MPT	11	36"	4		
	XR-38M-32-36-ZDC	2" IPS (.216 WALL) x 2" MPT	11	36"	3		

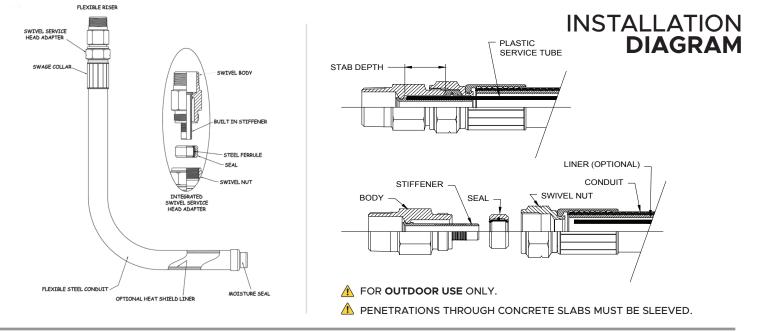

JOB NAME:		
JOB LOCATION:		
CONTRACTOR:	DATE:	ITEM TAG:
ENGINEER APPROVAL:	DATE:	PART NUMBER:

www.hydrapro.biz | (800) 849-4844 | Fax (877) 249-8435 Atlanta (GA) • Dallas (TX) • Houston (TX) • Pompano Beach (FL) • Jackson (MI)

SPECIFICATION SUBMITTAL SHEET

CHICAGO FITTINGS | X-RISER® FOR NATURAL GAS

- No underground joints
- No chamfering
- Bi-directional seal can't be installed improperly
- No torque requirements
- Integral barbed stiffeners are permanent for additional pull out resistance

3.1 Bodies	3.1.1	Tubing AISI C1013		MATERIAL			
	3.1.2	Bar AISI C12L14, C1213, C1215		DEFINITIONS			
	3.1.3	Bar CDA836 85-5-5-5 Bronze					
	3.1.4	Bar CDA360 Free Machining Brass					
3.2 Nuts	3.2.1	Tubing AISI C1013					
	3.2.2	Bar AISI C12L14, C1213, C1215					
	3.2.3	Bar CDA836 85-5-5-5 Bronze					
	3.2.4	Bar CDA360 Free Machining Brass					
3.3 Seals	3.3.1	Seals shall be manufactured from a Buna-N compound material that will resist					
		deterioration from age or air under normal storage conditions. The seal will resist					
		deterioration from impurities normally found in natural gas or LP gas including					
		odorants, liquid hydrocarbons, ca	rbon dioxide and water. Tl	he compound shall meet			
		the following specifications:					
		Color: Black/Red	Durometer: 75 +/-5				
		Elongation: 150%	Tensile Strength: 1,500 p	si min.			
3.4 Ferrules	3.4.1	Cold Rolled Strip C1050					
3.5 Insulators	3.5.1	Zytel 105					
3.6 Conduit	3.6.1	Core Material: Hot Dipped Galvan	ized Steel				
	3.6.2	Jacket Wall: Liquid Tight, Sunlight Resistant					
	3.6.3	Crush Resistance: 1,200psi min. in	accordance with UL 360				
3.7 Casing	3.6.1	Pipe/Tubing ASTM A53, ASTM A5	13				
3.8 Moisture Seals	3.7.1	Hot Dipped Vinyl					

INSTALLATION PROCEDURE

- 1. Remove body and install body into meter valve, regulator or piping system First.
- 2. Insert plastic service tube thru the riser assembly and extend the plastic a minimum of 5" past the end of swivel nut.
- 3. Cut the plastic tubing square and deburr O.D. and I.D. Clean exposed tubing with a clean, dry, grease free cloth making sure not to scratch the surface of the plastic tubing.
- 4. Mark tubing to stab depth (SEE CHART) with felt tip pen or suitable marker. Make sure not to scratch surface of plastic tubing with marker.
- 5. Slip seal over plastic service tube and slide seal into the swivel nut.
- 6. Stab plastic up into body until end of body is flush to within a 1/8" of the mark.
- 7. Push swivel nut towards body threads and engage threads. Tighten swivel nut and body until fitting becomes iron bound, that is, "metal to metal".